akribis

CARE AND USE MANUAL

Topsil Silica HPLC Column Care and Use Manual

Welch

Distributed by AKRIBIS



Topsil Silica HPLC Column
Care and Use Manual

Dear User:

Thank you for choosing our liquid chromatography column products! This manual is designed to help you use our products under optimal conditions and maximize column lifespan. Please read the usage instructions carefully before operation.

Topsil Silica is suitable for the separation of highly polar compounds and lipophilic compounds, offering distinct selectivity compared to other silica columns from Welch Materials. With lower column pressure and higher efficiency, it is an economical HPLC column choice.

Preparation Before Use

Column Identification

To ensure the quality of every column, each column sold by Welch Materials is assigned a unique identification code. This code allows us to trace quality-related issues. Upon receiving your column, please follow these steps:

1. Verify that the packaging is intact and matches the ordered column model.
2. Ensure the package contains a COA report with the inspector's signature.
3. Check the column surface for any damage and confirm that the protective plugs on both ends are intact.
4. Verify that the column body bears a Welch Materials identification label. Confirm that the model and serial number on the box match those on the column label.

Note:

The packing material inside the column is composed of fine particles. Do not attempt to open the column arbitrarily, as the material may become airborne and pose a health risk. If opening is necessary, use appropriate protective measures.

Installation

To achieve optimal column efficiency, use narrow-diameter tubing for connections. The connections to the column inlet and outlet must be tightly sealed, with the tubing ends polished and free of burrs or bevels. Use professional tools to cut and trim tubing.

1. Remove the column from its packaging. Check the direction of the eluent flow indicated by the arrow on the column body. Unscrew the protective plugs at both ends of the column. Position the column so that the eluent flow aligns with the direction indicated, as shown in Figure 1.

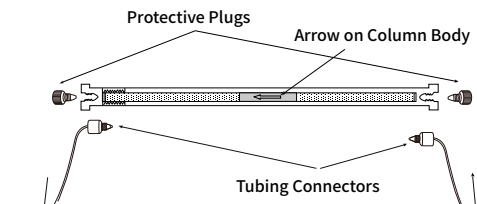


Figure 1. Column Installation

2. Carefully screw stainless steel or other compatible material fittings into both ends of the column. Ensure tight, zero-dead-volume connections to prevent leakage during operation.

Product Specifications

Column	Topsil Silica
USP Code	L3
Pore Size	150 Å
Specific Surface Area	260 m^2/g
Carbon Loading	/
pH Range	2.0-8.0
Max. Temperature	70 °C (mobile phase pH ⩽6.5)
	40 °C (mobile phase pH ＞6.5)
Max. Pressure Tolerance	40 MPa

Note:

When using silica-based columns at pH＞7, use buffers with concentrations not exceeding 20 mM and temperatures not exceeding 40 °C to maximize column lifespan. Extreme pH or temperature conditions can significantly reduce column durability.

Column Activation

(Recommended for new columns or those unused for over a month)

Topsil Silica columns are shipped in a solution of 99.5% n-hexane and 0.5% isopropanol. Activation should follow these steps:

Reversed-phase Mode (Method mobile phase contains polar solvents such as methanol, acetonitrile, water)

Step 1: Activation

Activation Procedure		
Specification	ID⩽3 mm	ID＞3 mm
Flow Rate	0.1 mL/min	0.3 mL/min
Mobile Phase	100% Isopropanol	
Time	12 hours	
Temperature	30 °C	

Step 2: Transition

Transition Procedure		
Specification	ID⩽3 mm	ID＞3 mm
Flow Rate	0.2 mL/min	1 mL/min
Mobile Phase	100% Acetonitrile	
Time	2 hours	
Temperature	30 °C	

Step 2 is skipped if no buffer salts are involved.

Column Activation

Normal-phase Mode (Method mobile phase contains weak polar solvents such as n-hexane, isopropanol)

Step 1: Activation

Activation Procedure		
Specification	ID⩽3 mm	ID＞3 mm
Flow Rate	0.1 mL/min	0.2 mL/min
Mobile Phase	100% Isopropanol	
Time	4 hours	
Temperature	30 °C	

Step 2: Transition

Transition Procedure		
Specification	ID⩽3 mm	ID＞3 mm
Flow Rate	0.2 mL/min	1 mL/min
Mobile Phase	Transition mobile phase	
Time	2 hours	
Temperature	30 °C	

Step 2 is skipped if no buffer salts are involved.

Routine Column Washing (Backflush is Recommended):

Method Mobile Phase	Without acids, bases, salts, or acetonitrile in water	Containing acids, bases, salts, or acetonitrile in water	N-hexane, Isopropanol, etc.
Washing Mobile Phase	100% Acetonitrile	60% → 100% Acetonitrile	100% Isopropanol
Flow Rate	Method Flow Rate		
Time	30 mins each (Column Length ⩽100mm)		
	40 mins each (Column Length ＞100mm)		
Storage	Store the column in the final washing solvent, with protective plugs tightly sealed. Place in a cool, dry place.		

Column Regeneration:

If the column exhibits increased pressure, abnormal peak shapes, reduced efficiency, or decreased resolution, first flush with a transition mobile phase (60% methanol or 60% acetonitrile) to remove salts. Then wash as follows:

Method Mobile Phase	Methanol, acetonitrile, water, etc.	N-hexane, isopropanol, etc.
Flow Rate	Method Flow Rate	
Mobile Phase	100% Methanol → 100% Acetonitrile → 100% Isopropanol → 100% Acetonitrile	100% Isopropanol → 100% Methanol → 100% Isopropanol
Time	30 mins each (Column Length ⩽100mm)	
	40 mins each (Column Length ＞100mm)	
Note	Isopropanol's high viscosity increases pressure; adjust flow rate within range.	

Glossary of Terms:

pH Range: The pH range tolerable for the column's mobile phase and sample solutions.

Specific Surface Area: The surface area per gram of silica.

Pore Size: The diameter of pores within silica particles, selected based on analyte molecular weight.

Carbon Loading: The percentage of carbon content in bonded functional groups relative to the total silica mass.

USP Code: Universal code for bonded phases in the USP chromatography column database.

Transition Mobile Phase: A solvent used to gradually adjust the type and ratio of mobile phase, typically free of buffers, acids, and bases.

Transition Procedure: A procedure to ensure miscibility between activation mobile phase and method mobile phases using transition mobile phase.

Maximum Pressure Tolerance: The upper pressure limit the column can withstand. Long-term use is recommended at pressures below 30 MPa. Monitor the instrument's pressure for safe operation.

Storage Solvent: Solvent used during storage or transport to maintain the activity of packing material. Handle with appropriate protective measures.